

Ship Name: AMBASSADOR II	Ship Type: Passenger Ship
IMO Number: 7011515	Flag: Bahamas
Date of Action: 07/15/2004	Class Society: Lloyd's Register of Shipping
Action Taken: Detention	Recognized Security
Port: Miami, Florida	Ship Management: <u>Owners, Operators, Managers or Charterers</u> International Shipping Partners Sterling Casino Lines

Deficiencies:	<u>Code - Category</u>	<u>Description</u>
	2510 - Safety and environmental policy	Company has not ensured that the safety and environmental protection policy is implemented and maintained at all levels of the organization, both ship based and shore based.
	2510 - Safety and environmental policy	Company has not implemented functional requirements that address the "safety and environmental protection policy". Specifically : a. Levels of competency for station bill duties are not clearly defined and personnel are not adequately qualified.
	2530 - Resources and Personnel	The company has not ensured that the vessel was manned with qualified, certified and medically fit seafarers in accordance with national and international requirements. Specifically: Crew members were not licensed and certificated.
	2510 - Safety and environmental policy	Company has not implemented functional requirements that address "instructions and procedures to ensure safe operation of ships and protection of the environment in compliance with relevant international and flag state legislation.
	2530 - Resources and Personnel	Company has not implemented functional requirements that address 'defined levels of authority and lines of comms: specifically no procedures for ensuring training required in support of the SMS is provided for all personnel concerned.
	2530 - Resources and Personnel	Company does not ensure that the ships personnel are able to communicate effectively in the execution of their SMS duties.
	2510 - Safety and environmental policy	The company's SMS does not ensure compliance with mandatory rules and regulations. E.g.. Majority of crew not in compliance with STCW 95. Crew members not licensed in accordance with STCW 95.
	0299 - Other (Crew)	No documentation for personel with designated safety or pollution prevention duties.
	0299 - Other (Crew)	No specialized training documentation for personnel on board passenger ships.
	2565 - Certification, verification and control	Based on deficiencies numbered 1-12 and 26-28, the validity and/or implementation of the vessels SMS is in question, and therefore, the flag state or

recognized organization shall attend the vessel to conduct and external ISM audit.

Ship Name:	APL MIAMI	Ship Type:	General Dry Cargo Ship
IMO Number:	9164421	Flag:	Antigua and Barbuda
Date of Action:	07/04/2004	Class Society:	Germanischer Lloyd
Action Taken:	Detention	Recognized Security	
Port:	San Juan, Puerto Rico	Ship Management:	<u>Owners, Operators, Managers or Charterers</u> Sirus-Schiffahrtsgesellschaft APL
Deficiencies:	<u>Code - Category</u> 0740 - Pumps	<u>Description</u> Emergency fire pump and the #2 fire main pump inoperable.	

Ship Name:	BARON	Ship Type:	General Dry Cargo Ship
IMO Number:	8911619	Flag:	Panama
Date of Action:	07/14/2004	Class Society:	Korean Register of Shipping
Action Taken:	Detention	Recognized Security	
Port:	Dutch Harbor, Alaska	Ship Management:	<u>Owners, Operators, Managers or Charterers</u> Oswego LTD
Deficiencies:	<u>Code - Category</u> 2199 - Other (MARPOL Related Operational Def.) 1710 - Oil record book	<u>Description</u> Vessel bypassed OWS and illegally discharged oil into the sea. Vessel falsified entries in their oil record book.	

Ship Name:	COZUMEL CEMENT	Ship Type:	Bulk Carrier
IMO Number:	8101915	Flag:	Denmark
Date of Action:	07/01/2004	Class Society:	Det Norske Veritas
Action Taken:	Detention	Recognized Security	Det Norske Veritas
Port:	Port Canaveral, Florida	Ship Management:	<u>Owners, Operators, Managers or Charterers</u> Kristian Gerhard Jebsen Skipsrederi A/S
Deficiencies:	<u>Code - Category</u> 2545 - Reports/analysis of non-conformities, etc. 0899 - Other (accid. prevent.) 2525 - Masters responsibility and authority 1299 - Other (Load Lines) 2565 - Certification, verification and control	<u>Description</u> No records/analysis of non-conformities. Damage scuttle, damaged ladder & fuel leaks. Fire hazards: numerous fuel & hydraulic oil leaks found on main generators, emergency fire pump auxiliary pumps & steering gear. Master has lack knowledge in ISPS & ISM Codes. Scuttle leading to steering gear compartment severely wasted. Based on deficiencies identified above, the validity and/or implementation of the vessel's SMS is in question, and therefore, the flag state or	

recognized organization is requested to conduct an external audit.

Ship Name:	DORTHE MAERSK	Ship Type:	General Dry Cargo Ship
IMO Number:	9105920	Flag:	Germany
Date of Action:	07/26/2004	Class Society:	Germanischer Lloyd
Action Taken:	Detention	Recognized Security	
Port:	Alameda, California	Ship Management:	<u>Owners, Operators, Managers or Charterers</u> Leonhardt & Blumberg Reederei- A.P. Moller Schiffahrts-Gesellschaft
Shipmanagement			
Deficiencies:	<u>Code - Category</u> 0799 - Other (Fire Fighting Equipment) 1730 - Oily-water separating equipment 0111 - Cargo ship safety construction	<u>Description</u> The crew is using the steering flat as a storage for paint. According to the fireplan, this area is not approved for paint storage. Verification of proper maintenance of oily water separator must be provided; OWS currently inoperative. There are various oil leaks throughout the engine room and hydraulic leaks in the steering flat.	
Ship Name:	EDISONGRACHT	Ship Type:	Bulk Carrier
IMO Number:	9081289	Flag:	Netherlands
Date of Action:	07/26/2004	Class Society:	Lloyd's Register of Shipping
Action Taken:	Detention	Recognized Security	
Port:	San Juan, Puerto Rico	Ship Management:	<u>Owners, Operators, Managers or Charterers</u> c.v scheepurt.ondern.lemmergracht splithoff bevr.kanf. C.V. Scheepurt.Ondernemmergracht
Deficiencies:	<u>Code - Category</u> 0610 - Lifeboats	<u>Description</u> Reinstall lifeboat in freefall arrangement and repair broken access door to lifeboat.	
Ship Name:	EDSEL	Ship Type:	Ro-Ro-Cargo Ship
IMO Number:	8017891	Flag:	Hong Kong
Date of Action:	07/05/2004	Class Society:	Nippon Kaiji Kyokai
Action Taken:	Detention	Recognized Security	
Port:	San Juan, Puerto Rico	Ship Management:	<u>Owners, Operators, Managers or Charterers</u> Indochina Ship Management (UK) Ltd. Edsel Shipping Management
Deficiencies:	<u>Code - Category</u> 0740 - Pumps	<u>Description</u> Vessel emergency fire pump unable to produce adequate pressure .	

Ship Name: **OSTFRIESLAND**
IMO Number: **7720893**
Date of Action: **07/13/2004**
Action Taken: **Detention**

Ship Type: **Bulk Carrier**
Flag: **Singapore**
Class Society: **Nippon Kaiji Kyokai**
Recognized Security **Nippon Kaiji Kyokai**

Port: **Baltimore, Maryland**

Ship Management: Owners, Operators, Managers or Charterers
Jutha Maritime Public Co. Ltd.
Wallenius Wilhelmsen Lines America

Deficiencies: Code - Category
1530 - Radar

2555 - Documentation

Description
Secondary radar inoperative and not reported prior to arrival

Log books missing pre-arrival tests and discrepancies with radar log book in relation to damaged radar. This combined with other deficiencies provides objective evidence that vessel SMS is not fully implemented or not functioning. ISM Audit requested.

Ship Name: **SAF MARINE BIKO**
IMO Number: **8407187**
Date of Action: **07/03/2004**
Action Taken: **Detention**

Ship Type: **General Dry Cargo Ship**
Flag: **Cyprus**
Class Society: **Germanischer Lloyd**
Recognized Security **Germanischer Lloyd**

Port: **Philadelphia, Pennsylvania**

Ship Management: Owners, Operators, Managers or Charterers
Athinai Compania Maritima S.A.
Haliner Shipping Ltd.
Safmarine Lines

Deficiencies: Code - Category
0610 - Lifeboats

0610 - Lifeboats

0950 - Electric equipment in general

Description
Repair or replace all corroded and frayed lifeboat seat belts.

Make satisfactory repairs to FRP hatch combings on port and starboard lifeboats and repair dogging levers.

Prove proper operation of emergency generator cooling system and ventilation louvers.

Ship Name: **SEABOARD EXPLORER II**
IMO Number: **9103362**
Date of Action: **07/25/2004**
Action Taken: **Detention**

Ship Type: **Bulk Carrier**
Flag: **Bahamas**
Class Society: **Bureau Veritas**
Recognized Security

Port: **Houston, Texas**

Ship Management: Owners, Operators, Managers or Charterers
CEC Shipmanagement A/S
seaboard marine
CEC Marine Shipping Co.

Deficiencies: Code - Category
0720 - Fire fighting equipment

Description
General service pump is seized. Additional pumps, not including the emergency and service pump, do

not meet 40% total capacity requirement.

0950 - Electric equipment in general

General switchboard, earth ground detection on 220V detecting high levels of low insulation.

Ship Name: **SICHEM PEARL**

Ship Type: **Chemical Tankship**

IMO Number: **9084671**

Flag: **Singapore**

Date of Action: **07/27/2004**

Class Society: **Nippon Kaiji Kyokai**

Action Taken: **Detention**

Recognized Security

Port: **Philadelphia, Pennsylvania**

Ship Management: Owners, Operators, Managers or Charterers
Tesma (india) PVT Ltd

Deficiencies: Code - Category
0630 - Launch arrangt. for survival craft
0610 - Lifeboats
0696 - Record of inspections/maintenance
2020 - Fire drills
2510 - Safety and environmental policy

Description
Port forward davit arm wasted and holed in way of bend on top plate at corner.
Lifeboat spray curtain tests on port and starboard lifeboats need to be conducted.
Maintenance records erroneously indicates that davit arm was inspected on July 13, 2004 with no defects.
Crew unable to demonstrate proficiency in a fire drill.
Vessel crew was aware of holed davit on July 13, 2004, but failed to record or report to company as per the ships SMS.

Ship Name: **TROPIC SUN**

Ship Type: **Containership**

IMO Number: **9039016**

Flag: **Netherlands**

Date of Action: **07/07/2004**

Class Society: **Bureau Veritas**

Action Taken: **Detention**

Recognized Security

Port: **San Juan, Puerto Rico**

Ship Management: Owners, Operators, Managers or Charterers
Birdsall Shipping S.A.
Tropical Shipping & Construction Co.

Ltd.

Deficiencies: Code - Category
0684 - Means of recovery life saving appl.

Description
Port lifeboat davit assembly inoperable. Make repairs to the port lifeboat davity assembly.

Ship Name: **YOKAMU**

Ship Type: **Containership**

IMO Number: **7217054**

Flag: **Saint Vincent and the Grenadines**

Date of Action: **07/20/2004**

Class Society: **Govt of Listed Flag**

Action Taken: **Detention**

Recognized Security **Govt of Listed Flag**

Port: **Miami, Florida**

Ship Management: Owners, Operators, Managers or Charterers
Rainbow Group, Inc

Deficiencies: Code - Category

Description

1299 - Other (Load Lines)

Tape and epoxy in, on and around superstructure and along decks covering holes.

1299 - Other (Load Lines)

Electrical wire running through bulkhead, improper cable bulkhead penetration.

1270 - Doors

Forward watertight doors need to be inspected.